

Review of p-pol power measurements in KAGRA

First measurement 2022.8.31

<https://klog.icrr.u-tokyo.ac.jp/osl/?r=21953>

Measured p-pol power Unit: %

1st	POP	POS
ITMX	--	6.2
ITMY	--	10.7
Xarm locked	--	3.0
Yarm locked	--	4.5


Numbers are calibrated for central BS

R:T=50:50 for s-pol

R:T=20:80 for p-pol

Power measurements at POP this time were measured by CCD cameras which I think are not accurate. So they are not listed in the table.

POS layout

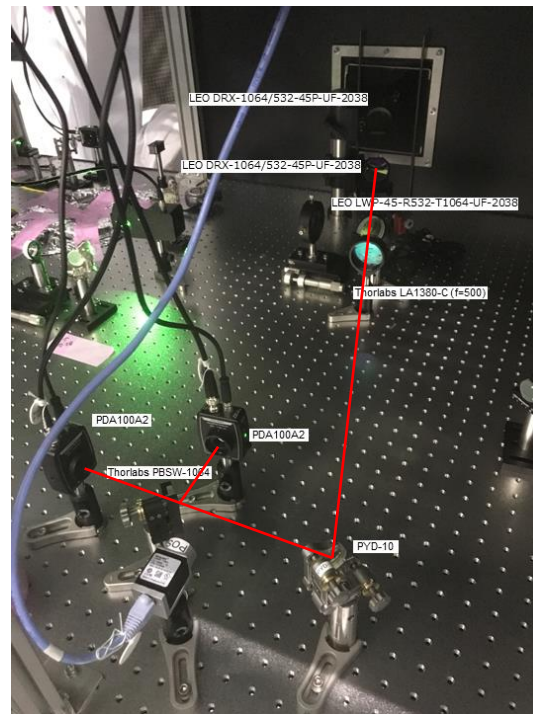

Second measurement 2022.9.1

<https://klog.icrr.u-tokyo.ac.jp/osl/?r=21966>

Measured p-pol power Unit: %

2nd	POP	POS
ITMX	6.6	6.1
ITMY	12.4	11.8
Xarm locked	2.1	2.7
Yarm locked	3.2	6.4

POP and POS
power matches
quite well (except
for Yarm locked)

Numbers are calibrated for central BS


R:T=50:50 for s-pol

R:T=20:80 for p-pol

Cameras were removed at that
time because we couldn't find
a proper lens.

POP layout

RBS1 mirror is removed because there may be clipping

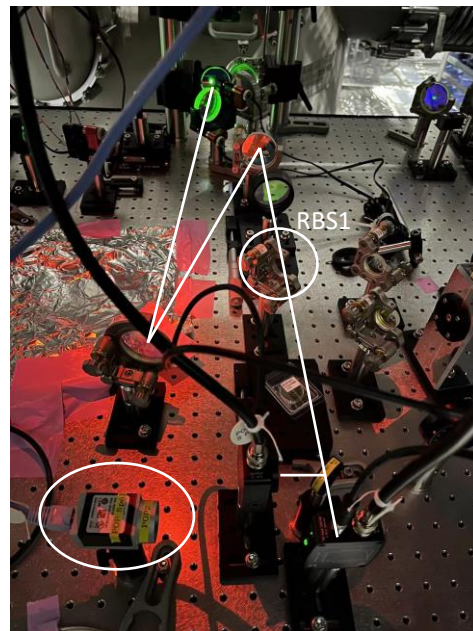

Third measurement A 2022.9.1

<https://klog.icrr.u-tokyo.ac.jp/osl/?r=22015>

Measured p-pol power Unit: %

3rd A	POP	POS
ITMX	3.63	5.86
ITMY	7.98	11.18
Xarm locked	0.68	2.63
Yarm locked	1.76	4.06

Numbers are calibrated for central BS

R:T=50:50 for s-pol


R:T=20:80 for p-pol

Cameras installed into the path

RBS1, RBS3 and RBS4 are Sigma-Koki
(NPPH(+/-5%)Q-25.4C06-20-W0.5D-1064)

POP layout

RBS1 is installed and replaced by Sigma optics.

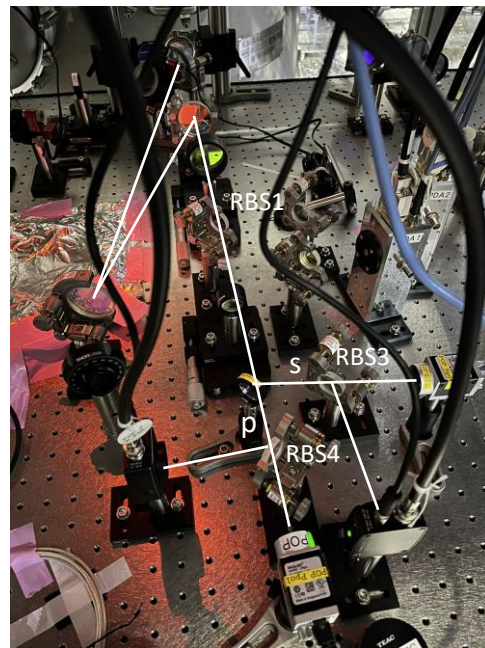

Third measurement B 2022.9.1

<https://klog.icrr.u-tokyo.ac.jp/osl/?r=22015>

Measured p-pol power Unit: %

3rd B	POP	POS
ITMX	3.65	4.98
ITMY	8.07	11.13
Xarm locked	0.77	1.78
Yarm locked	1.95	4.17

Numbers are calibrated for central BS

R:T=50:50 for s-pol

R:T=20:80 for p-pol

We found there may be ghost beam at POS. When we measure the reflection of one ITM, the other ITM is misaligned. If the misalignment is small, the misaligned beam may be seen by the PD as the sensing area of the PD is very large. **So an iris is put before the PBS.**



Comparison

RBS1 (Newport): T=48% for s-pol and T=78% for p-pol from data sheet

Nothing changed

RBS1 mirror at POP is removed
No change in POS

RBS1 replaced by Sigma NPBS
No change in POS

No change in POP
An iris added to POS to remove ghost beam

0	POP	POS	POP by CCD
ITMX	--	--	4.68 / 4.79
ITMY	--	--	9.35 / 9.16
Xarm locked	--	--	1.32 / 2.24
Yarm locked	--	--	2.60 / 2.35

Two measurements
2022.8.11 / 2022.8.15 <https://klog.icrr.u-tokyo.ac.jp/osl/?r=21953>

Measured p-pol power in %

1st	POP	POS	POP by CCD
ITMX	--	6.2	4.61
ITMY	--	10.7	10.2
Xarm locked	--	3.0	0.45
Yarm locked	--	4.5	1.54

2022.8.31

2nd	POP	POS
ITMX	6.6	6.1
ITMY	12.4	11.8
Xarm locked	2.1	2.7
Yarm locked	3.2	6.4

2022.9.1

3rd A	POP	POS
ITMX	3.63	5.86
ITMY	7.98	11.18
Xarm locked	0.68	2.63
Yarm locked	1.76	4.06

2022.9.1

3rd B	POP	POS
ITMX	3.65	4.98
ITMY	8.07	11.13
Xarm locked	0.77	1.78
Yarm locked	1.95	4.17

2022.9.1

POP power reduced after put RBS1 mirror back.
There may be two possibilities:
1. There may be clipping on RBS1: red numbers are wrong and cyan numbers are correct.
2. The RBS1 edge blocks ghost beam: red numbers are correct and cyan numbers are wrong.

P-pol power from ITMX is reduced at POS after adding the iris. But power from ITMY doesn't change.
There are ghost beam when doing ITMX measurement.

These numbers are more consistent with simulation results for single bounce and cavity locking!

Third measurement B 2022.9.1

If we suppose the last measurement is more accurate:

3rd B	POP	POS	The relative power difference between POP and POS are: (POS – POP) / POP	If we assume the difference comes from BS unbalance for p-pol, the correct transmission for p are:
ITMX	3.65	4.98	$(4.98 - 3.65) / 3.65 = 36.4\%$	$T_p = 74.3\%$
ITMY	8.07	11.13	$(11.13 - 8.07) / 8.07 = 37.9\%$	$T_p = 85.1\%$
Xarm locked	0.77	1.78	131%	
Yarm locked	1.95	4.17	114%	

BS unbalance error is not the only reason for power difference between POP and POS.

Also, the power difference after cavity locking is huge (for the same locking periods)!