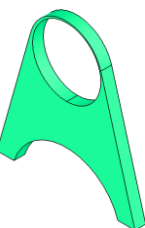
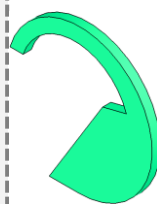
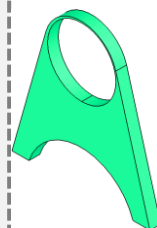
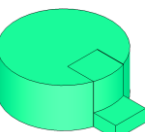
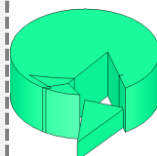


Target	Erroneous CAD	Error-Corrected CAD
	<pre> sketch0 = [] loop0_0 = Loop() loop0_0.Line(endpoint=(-9, 0)) loop0_0.Arc(endpoint=(78, 0), degrees=143, counterclockwise=False) loop0_0.Line(endpoint=(89, 0)) loop0_0.Arc(endpoint=(31, -78), degrees=254, counterclockwise=True) loop0_0.Line(endpoint=(56, -78)) loop0_0.Line(endpoint=(11, -5)) loop0_1 = Loop() loop0_1.Circle(center=(45, 108), radius=-22) sketch0.add(loop0_0) sketch0.add(loop0_1) Extrude(sketch=sketch0, orientation_degrees=(90, 90, 90), origin=(-39, 0, 0), scale=0.75, extrude_distance=(-7, 0), boolean_type='New', extent_type='One-sided') </pre> 	<pre> sketch0 = [] loop0_0 = Loop() loop0_0.Line(endpoint=(11, 0)) loop0_0.Arc(endpoint=(78, 0), degrees=143, counterclockwise=False) loop0_0.Line(endpoint=(89, 0)) loop0_0.Line(endpoint=(67, 78)) loop0_0.Arc(endpoint=(22, 78), degrees=148, counterclockwise=True) loop0_0.Line(endpoint=(0, 0)) loop0_1 = Loop() loop0_1.Circle(center=(45, 72), radius=22) sketch0.add(loop0_0) sketch0.add(loop0_1) Extrude(sketch=sketch0, orientation_degrees=(90, -90, 90), origin=(-45, 0, 0), scale=0.75, extrude_distance=(7, 0), boolean_type='New', extent_type='One-sided') </pre> 
	<pre> sketch0 = [] loop0_0 = Loop() loop0_0.Line(endpoint=(28, -5)) loop0_0.Arc(endpoint=(48, 29), degrees=323, counterclockwise=False) loop0_0.Line(endpoint=(0, 56)) loop0_0.Line(endpoint=(9, 0)) ... sketch1 = [] loop1_0 = Loop() loop1_0.Line(endpoint=(61, 0)) loop1_0.Line(endpoint=(0, 1)) loop1_0.Arc(endpoint=(128, 129), degrees=30, counterclockwise=True) loop1_0.Line(endpoint=(0, -95)) ... sketch2 = [] loop2_0 = Loop() loop2_0.Line(endpoint=(72, 0)) loop2_0.Line(endpoint=(60, 107)) loop2_0.Line(endpoint=(6, 81)) loop2_0.Arc(endpoint=(1, 0), degrees=-37, counterclockwise=False) ... </pre> 	<pre> sketch0 = [] loop0_0 = Loop() loop0_0.Line(endpoint=(36, 0)) loop0_0.Arc(endpoint=(36, 41), degrees=323, counterclockwise=False) loop0_0.Line(endpoint=(0, 41)) loop0_0.Line(endpoint=(0, 0)) ... sketch1 = [] loop1_0 = Loop() loop1_0.Line(endpoint=(83, 0)) loop1_0.Arc(endpoint=(83, 95), degrees=37, counterclockwise=True) loop1_0.Line(endpoint=(0, 95)) loop1_0.Line(endpoint=(0, 0)) ... sketch2 = [] loop2_0 = Loop() loop2_0.Line(endpoint=(72, 0)) loop2_0.Line(endpoint=(72, 95)) loop2_0.Line(endpoint=(0, 95)) loop2_0.Arc(endpoint=(0, 0), degrees=37, counterclockwise=False) ... </pre> 