

PREPARED FOR SUBMISSION TO JINST

TOPICAL WORKSHOP ON ELECTRONICS FOR PARTICLE PHYSICS
RETHYMNO, CRETE, GREECE
6–10 OCTOBER 2025

Radiation tolerance tests on key components of the ePIC-dRICH readout card

S. Geminiani^{d,n,*} B.R. Achari^{d,n} N. Agrawal^{d,n} M. Alexeev^{h,q} C. Alice^{h,q}
R. Ammendola^{ib,j} P. Antonioli^{ib,d} C. Baldanza^d L. Barion^{ib,f} A. Biagioni^{ib,i}
A. Calivà^{ib,b,r} M. Capua^{ib,a,m} F. Capuani^{ib,i} A. Ciardiello^{ib,i,t} E. Cisbani^{ib,i,k}
M. Chiosso^{ib,h,q} M. Contalbrigo^{ib,f} F. Cossio^{ib,h} M. Da Rocha Rolo^{ib,h} A. De Caro^{ib,b,r}
D. De Gruttola^{ib,b,r} G. Dellacasa^{ib,h} D. Falchieri^{ib,d} S. Fazio^{ib,a,m} O. Frezza^{ib,i}
N. Funicello^{ib,b,r} M. Garbini^{ib,d,l} N. Jacazio^{ib,h,s} F. Lo Cicero^{ib,i} A. Lonardo^{ib,i}
R. Malaguti^{ib,f} F. Mammoliti^{ib,c} M. Martinelli^{ib,i} M. Mignone^{ib,h} C. Mingioni^h M. Nenni^h
F. Noto^{ib,c} L. Occhiuto^{ib,a,m} A. Paladino^{ib,d} D. Panzieri^{ib,h,s} P. Perticaroli^{ib,i}
S. Plavully^{ib,f} L. Polizzi^{ib,f,o} L. Pontisso^{ib,i} R. Preghenella^{ib,d} R. Ricci^{ib,d}
L. Rignanese^{ib,d} C. Ripoli^{ib,b,r} C. Rossi^{ib,i,t} E. Rovati^{ib,d,n} N. Rubini^{ib,d} M. Ruspa^{ib,h,s}
A. Saputi^{ib,f} F. Simula^{ib,i} F. Spizzo^{ib,f} U. Tamponi^{ib,h} E. Tassi^{ib,a,m} G. Torromeo^{ib,d}
C. Tuvè^{ib,e,p} G.M. Urciuoli^{ib,i} S. Vallarino^{ib,g} P. Vicini^{ib,i} R. Wheadon^{ib,h}

^aINFN Gruppo Collegato di Cosenza, Ponte Pietro Bucci 31 C, Rende, Italy

^bINFN Gruppo Collegato di Salerno, Via Giovanni Paolo II 132, Fisciano, Italy

^cINFN Laboratori Nazionali del Sud, Via S. Sofia 62, Catania, Italy

^dINFN Sezione di Bologna, Viale C. Berti Pichat 6/2, Bologna, Italy

^eINFN Sezione di Catania, Via S. Sofia 64, Catania, Italy

^fINFN Sezione di Ferrara, Via Saragat 1, Ferrara, Italy

^gINFN Sezione di Genova, Via Dodecaneso 33, Genova, Italy

^hINFN Sezione di Torino, Via Pietro Giuria 1, Torino, Italy

ⁱINFN Sezione di Roma 1, Piazzale Aldo Moro 2, Roma, Italy

^jINFN Sezione di Roma 2, Via della Ricerca Scientifica 1, Roma, Italy

^kIstituto Superiore di Sanità, Viale Regina Elena 299, Roma, Italy

^lMuseo Storico della Fisica e Centro Studi e Ricerche Enrico Fermi, Via Panisperna 89 A, Roma, Italy

^mUniversità della Calabria, Ponte Pietro Bucci 31 C, Rende, Italy

ⁿUniversità degli Studi di Bologna, Viale C. Berti Pichat 6/2, Bologna, Italy

*Corresponding author.

This is the Accepted Manuscript version of an article accepted for publication in Journal of Instrumentation. Neither SISSA Medialab Srl nor IOP Publishing Ltd is responsible for any errors or omissions in this version of the manuscript or any version derived from it. The Version of Record is available online at DOI: 10.1088/1748-0221/21/04/C04039.

^o *Università degli Studi di Ferrara, Via Saragat 1, Ferrara, Italy*

^p *Università degli Studi di Catania, Via S. Sofia 64, Catania, Italy*

^q *Università degli Studi di Torino, Via Pietro Giuria 1, Torino, Italy*

^r *Università degli Studi di Salerno, Via Giovanni Paolo II 132, Fisciano, Italy*

^s *Università del Piemonte Orientale, Via del Duomo 6, Vercelli, Italy*

^t *Sapienza Università di Roma, Piazzale Aldo Moro 5, Roma, Italy*

E-mail: sandro.geminiani2@unibo.it

ABSTRACT: The dual-radiator RICH (dRICH) detector of the ePIC experiment will employ over 300000 SiPM pixels as photosensors, organized into more than 1000 Photon Detection Units. Each PDU is a compact module, approximately $5 \times 5 \times 12 \text{ cm}^3$ in size, including four custom ASICs connected to 256 SiPMs and an FPGA-based readout card (RDO) responsible for data acquisition and control.

Considering the moderately harsh radiation environment expected in the dRICH detector, this study reports on proton irradiation tests performed on key components of the RDO card to assess their tolerance to cumulative Total Ionizing Dose (TID) and Single Event Effects (SEE). All tested components demonstrated radiation tolerance beyond the TID levels expected for the dRICH environment, with the exception of the ATtiny817 microcontroller, which showed destructive failure. Furthermore, as expected, the observed Single Event Upset (SEU) rates call for appropriate mitigation strategies in the final system design.

KEYWORDS: Cherenkov detectors, Front-end electronics for detector readout, Radiation-hard electronics, Radiation damage to electronic components.

Contents

1	Introduction	1
2	The RDO card	2
3	Irradiation tests of key RDO components	3
3.1	Test setup instrumentation and methods	3
3.2	Results	4
4	Conclusions and outlook	5

1 Introduction

The ePIC (Electron–Proton–Ion Collider) experiment will be the first collision experiment to explore the physics program of the future Electron–Ion Collider (EIC) [1]. As part of the ePIC particle identification system, the dRICH detector will provide $\pi/K/p$ separation from 3 GeV/c up to 50 GeV/c and electron identification up to 15 GeV/c [2]. The selected photosensors are $3 \times 3 \text{ mm}^2$ SiPMs and are organized into 1248 PDUs, each integrating the readout electronics and 256 SiPMs.

Within the PDU electronics region, the maximum hadron flux with energy greater than 20 MeV (relevant for SEU effects) is estimated to be $\phi_5(h > 20 \text{ MeV}) \simeq 700 \text{ Hz/cm}^2$. The expected total ionizing dose is $\text{TID}_5 \simeq 2.3 \text{ krad}$. Both values assume an integrated luminosity of 1000 fb^{-1} and a safety factor of five. Cumulative TID effects and potential Single Event Latch-ups (SEL) may lead to permanent damage, while SEUs can corrupt device configuration or induce logic inversion in digital signals.

The PDU, shown in figure 1, is the result of a collaborative effort among several INFN divisions, including the development of the SiPM sensor system, the ALCOR ASIC [3] and the RDO readout card. In situ-annealing techniques have been intensively tested to partially recover SiPM performance after radiation-induced damage [4]. Furthermore, irradiation tests of the RDO-selected components are initiated to assess their radiation tolerance and finalize the RDO layout. According to the test outcomes, device replacement will be considered and related SEU mitigation strategies will be developed.

This contribution presents the results of the first two irradiation campaigns carried out at the Proton Therapy Center in Trento on key components of the RDO card.

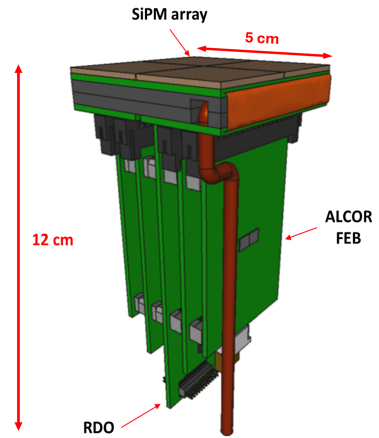


Figure 1. PDU design: SiPM arrays, the ALCOR ASIC Front-End Boards and the RDO readout card.

2 The RDO card

The PDU readout concept is illustrated on the left side of figure 2. It employs four 64-channel SiPM arrays as photosensors. Each array is coupled to a Front-End Board (FEB) hosting the ALCOR ASIC, which provides precise time stamping for each SiPM channel with a least significant bit (LSB) resolution of 40 ps. All FEBs are connected to the RDO card via high-speed board-to-board connectors. The on-board FPGA on the RDO acts as a data concentrator for the ALCOR chips. The data-push architecture of ALCOR, together with the FPGA firmware design, enables a streaming readout scheme, transmitting data to the back-end system through a 10 Gb/s optical link.

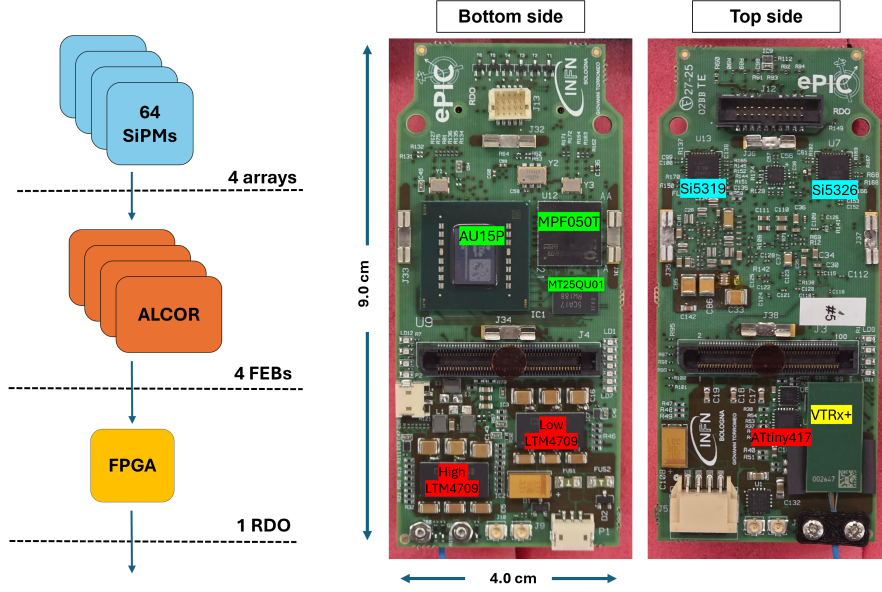


Figure 2. *Left:* schematic of the PDU readout concept, showing the signal path from the 64-channel SiPM arrays through the ALCOR Front-End Boards to the AU15P SRAM-based FPGA hosted on the RDO card. *Right:* layout of the RDO card, with the main components highlighted in different colors for each subsystem.

The RDO must fit within the PDU module; therefore, its design is compact, while ensuring high-speed data communication and radiation tolerance. Figure 2 (right) shows the RDO card, with its main components highlighted in different colors according to the corresponding subsystem:

- *FPGA subsystem:* an AU15P SRAM-based FPGA from AMD implements the high-speed readout of the differential data lines from the ALCOR chips. An MPF050T FLASH-based FPGA from Microchip reads and writes the AU15P Configuration RAM (CRAM) using an MT25QU01 FLASH memory from Micron Technology. The MPF050T operates as a scrubber for the AU15P CRAM to mitigate SEU occurrences.
- *Clock network:* two precision clock multipliers with jitter attenuation (Si5326 and Si5319, Skyworks Solutions) are used. The Si5326 provides a 394 MHz clock to the ALCOR chips and for ALCOR–AU15P communication. The Si5319 generates the reference clock of the AU15P transceiver, using a 40 MHz on-board crystal oscillator (Si511, Skyworks Solutions) that also serves as the clock source for the MPF050T FPGA.

- *Power network*: composed of two LTM4709 linear voltage regulators from Linear Technology; each regulator receives one of the two board power rails 1.4 V (Low-LTM4709) and 2.7 V (High-LTM4709). Each LTM4709 integrates a triple-LDO circuit that generates three output voltages used for the board low-voltage networks. An ATtiny417 microcontroller (μC) from Microchip drives the power-up and power-down sequences of the board and monitors SEL conditions on each output rail.
- *Optical interface*: the VTRx+ module, developed at CERN, is a radiation-hard optical transceiver directly connected to the AU15P FPGA [5].

3 Irradiation tests of key RDO components

The first RDO prototypes were received in July 2025. Two irradiation campaigns were conducted in December 2024 and September 2025 to test several key RDO components hosted on commercial evaluation boards. The tests were performed at the Proton Therapy Center in Trento, using the experimental room instrumented by INFN-TIFPA. The proton beam characterization is described in [6].

3.1 Test setup instrumentation and methods

Based on the available proton flux and beam spot size at different proton energies [6], the optimal beam energy was selected to maximize the fluence on the device die while maintaining the SEU rate within controllable limits. Table 1 summarizes the proton beam configurations used for each Device Under Test (DUT). An ATtiny817 μC was employed instead of the ATtiny417, as it provides the same package with larger memory resources.

Table 1. Irradiation parameters for each DUT (the commercial evaluation boards used are also listed)

DUT	Evaluation board	Beam energy (MeV)	Flux (Hz/cm^2)
Si5326	Skyworks Si5326 EVB	100	10^8
AU15P	Alinx AXAU15	70	10^6 - 10^7
ATtiny817	Microchip ATtiny817-XMINI	100	10^7 - 10^8
LTM4709	Analog Devices EVAL-LTM4709-BZ	100	10^7 - 10^8

The TIFPA setup includes a gaseous ionization detector between the beam aperture and the DUT to measure total fluence and estimate the total ionizing dose with $\approx 5\%$ precision. A host PC controlled the DUT power supply and monitored current for SELs. The AXAU15 FPGA firmware monitored upsets in the Si5326 clock generator and in its own memory locations, using for CRAM the AMD Soft Error Monitor (SEM) IP core. The ATtiny817 μC monitored its internal RAM and FLASH memories via the serial interface, while a Teensy 4.1 monitored the LDO voltage regulators.

Since most devices integrate multiple memory types, the Mean Time Between Failures (MTBF) for each DUT was estimated using the following equation:

$$\text{MTBF}_{\text{dRICH}} = (N_{\text{RDO}} \cdot N_{\text{dev}} \cdot N_{\text{bit}} \cdot \phi_5 \cdot \sigma_{\text{SEU}})^{-1}, \quad (3.1)$$

where N_{RDO} is the total number of dRICH RDO cards, N_{dev} the number of identical devices of the same technology integrated on the card, N_{bit} the maximum number of exposed bits, and σ_{SEU} the estimated SEU cross-section. Therefore, the $\text{MTBF}_{\text{dRICH}}$ value represents the average time interval between two consecutive SEUs in the entire dRICH system.

3.2 Results

In December 2024, the AU15P FPGA, the Si5326 clock multiplier and the ATtiny817 μC were irradiated. A TID = 49 krad was accumulated on the Si5326 device, with no evidence of SEL or permanent damage. Using an IPbus connection [7] between the AXAU15 board and the host PC, a SEU monitor was implemented to verify the configuration memory and check signals associated with output clock stability. A $\sigma_{\text{SEU}} = (1.8 \pm 0.4) \cdot 10^{-14} \text{ cm}^2/\text{bit}$ was estimated for its configuration memory and an $\text{MTBF}_{\text{dRICH}} = (4.4 \pm 1.0) \text{ h}$ was derived, considering both Skyworks Solutions devices hosted on the board. No clock-flag alerts were observed for the generated 394 MHz clock. Additionally, a period-jitter measurement was performed with an oscilloscope operating at a 40 GHz sampling frequency. The measured RMS jitter remained stable, with a maximum deviation of approximately 0.1 ps. The ATtiny817 device ceased functioning at TID = 28 krad, without evidence of SELs. Considering its SRAM memory, a $\sigma_{\text{SEU}} = (3.2 \pm 0.7) \cdot 10^{-14} \text{ cm}^2/\text{bit}$ and an $\text{MTBF}_{\text{dRICH}} = (4.8 \pm 1.1) \text{ h}$ were estimated. Since no SEUs were detected for its FLASH memory, 95% C.L. limits were computed as explained in [8]: $\sigma_{\text{SEU}} < 2.4 \cdot 10^{-16} \text{ cm}^2/\text{bit}$ and $\text{MTBF}_{\text{dRICH}} > 42 \text{ h}$. For the AU15P FPGA, a total dose of TID = 6.2 krad was accumulated without any observed SELs or damage. The FPGA was programmed for self-detection of SEUs and via the IPbus link it was possible to monitor flip-flops, CRAM, and Block RAM (BRAM). The software on the host PC monitored memory locations for errors, applying the appropriate corrective actions. The values of σ_{SEU} and $\text{MTBF}_{\text{dRICH}}$ are reported in table 2.

Table 2. Estimated values of σ_{SEU} and $\text{MTBF}_{\text{dRICH}}$ for each AU15P resource type.

Resource type	$\sigma_{\text{SEU}} \text{ (cm}^2/\text{bit)}$	$\text{MTBF}_{\text{dRICH}} \text{ (min)}$
CRAM	$(2.3 \pm 0.3) \cdot 10^{-16}$	(2.4 ± 0.3)
BRAM	$(1.8 \pm 0.2) \cdot 10^{-15}$	(2.1 ± 0.3)
Flip-flop	$< 4.3 \cdot 10^{-14} \text{ (95\% C.L.)}$	$> 2.8 \text{ (95\% C.L.)}$

In September 2025, two LTM4709 devices were irradiated. The LTM4709 tests were carried out under two voltage configurations and power consumptions corresponding to the RDO operating configuration. The output voltages and current monitor (IMON) signals were monitored. The Power-Good (PG) signals, which provide alerts for V_{out} faults, were used as interrupt triggers to the μC to detect SEU occurrences. In this context, a SEU was defined as a transient glitch in V_{out} , IMON or PG signals, corresponding to a transition of the PG signals. Figure 3 shows the V_{out} and IMON evolution as a function of the integrated dose up to approximately 60 krad. A small decrease in both current and voltage was observed. At TID ~ 60 krad a 5% maximum decrease of the initial value was measured for both V_{out} rails and the IMON signals. No large variations were observed below TID = 20 krad. Occasional faults on the power rails, detected at higher

doses, were recovered by toggling the Enable (EN) signals of each LDO circuit. Since no memory elements are exposed in this configuration, a value of $N_{\text{bit}} = 1$ was used in equation 3.1. For doses up to 20 krad, a $\sigma_{\text{SEU}} = (1.1 \pm 0.5) \cdot 10^{-11} \text{ cm}^2/\text{bit}$ and an $\text{MTBF}_{\text{dRICH}} = (14 \pm 7) \text{ h}$ were determined. An additional test was also performed on five ATtiny817 μCs aligned along the beamline. The low radiation tolerance of the device was confirmed: as all five units ceased communication with the SEU monitor beyond $\text{TID} > 8 \text{ krad}$, with a total accumulated dose of 31 krad across all devices. For the SRAM memory, a higher $\sigma_{\text{SEU}} = (5.6 \pm 1.1) \cdot 10^{-14} \text{ cm}^2/\text{bit}$ and a lower $\text{MTBF}_{\text{dRICH}} = (2.8 \pm 0.5) \text{ h}$ were estimated. Considering FLASH memory, new 95% C.L. limits were computed: $\sigma_{\text{SEU}} < 4.2 \cdot 10^{-17} \text{ cm}^2/\text{bit}$ and $\text{MTBF}_{\text{dRICH}} > 240 \text{ h}$.

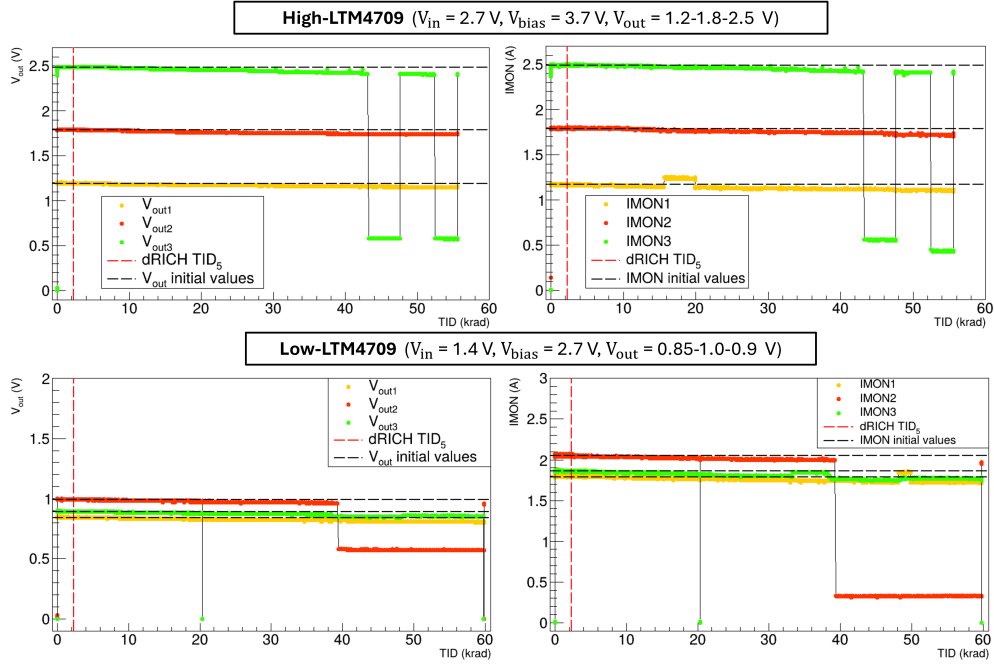


Figure 3. *Top:* V_{out} and IMON as a function of TID for the High-LTM4709 configuration. *Bottom:* V_{out} and IMON as a function of TID for the Low-LTM4709 configuration.

4 Conclusions and outlook

From the standpoint of radiation tolerance, the finalization of the RDO layout requires that all its components be validated through irradiation tests. Following the first two test campaigns, all tested devices were qualified up to a TID exceeding TID_5 , except the ATtiny817 μC , which failed destructively; alternative COTS solutions will replace the ATtiny417. SEU mitigation is required based on MTBF estimates: Skyworks jitter attenuators will be refreshed well below $\text{MTBF}_{\text{dRICH}}$, AU15P firmware will handle BRAM and flip-flop SEUs, and the MPF050T FPGA will implement CRAM scrubbing. The new μC will monitor V_{out} , IMON, and PG signals to control EN lines of both LTM4709 devices, in case of failure.

The RDO card will be tested in future campaigns to validate the implemented SEU mitigation strategies, as well as the remaining selected components that have not yet been tested.

Acknowledgments

This work is funded by the Commissione Scientifica Nazionale 3 (CSN3) of the Istituto Nazionale di Fisica Nucleare, Italy. This work is supported by the U.S. Department of Energy, Office of Science, Office of Nuclear Physics under the EIC project number JSA-22-R412967. The authors would like to thank the TIFPA staff for their help during the irradiation campaigns.

References

- [1] R. Abdul Khalek et al., *Science Requirements and Detector Concepts for the Electron-Ion Collider: EIC Yellow Report*, *Nucl. Phys. A* **1026** (2022) 122447.
- [2] T. Ullrich, *Requirements and R&D for detectors at the future Electron-Ion Collider*, *Nucl. Instrum. Meth. A* **1039** (2022) 167041.
- [3] F. Cossio et al., *ALCOR: A mixed-signal ASIC for the dRICH detector of the ePIC experiment at the EIC*, *Nucl. Instrum. Meth. A* **1069** (2024) 169817.
- [4] B.R. Achari et al., *The SiPM photodetector of the ePIC dual-radiator RICH at the EIC: overview and beam test results*, *JINST* **20** (2025) C08025.
- [5] J. Troska et al., *The VTRx+, an optical link module for data transmission at HL-LHC*, *PoS TWEPP-17* (2017) 048.
- [6] F. Tommasino et al., *Proton beam characterization in the experimental room of the Trento Proton Therapy facility*, *Nucl. Instrum. Meth. A* **869** (2017) 15.
- [7] C. Ghabrous Larrea et al., *IPbus: a flexible Ethernet-based control system for xTCA hardware*, *JINST* **10** (2015) C02019.
- [8] European Space Components Coordination, *Single Event Effects (SEE) Test Method and Guidelines*, Tech. Rep. ESCC Basic Specification No. 25100, European Space Agency (2014).